

# 356 SOP CO MONITOR INSTALLATION



CO MONITOR ON Q-BERTH HANGING LOCKER

SCREW LOCATIONS TO SECURE MONITOR  
(SAME PLACE ON OTHER SIDE)

#	Qty.	Description	Size	Part #
1	1	CO Monitor	N/A	353315
2	2	Monitor Fastener	#6 X 5/8" P/H	466870
3	2	Butt connectors	Blue	257570
4	1	Flexible Conduit	3/8"	656405

1. One carbon monoxide (CO) monitor will be installed in this stage. It will be located on the aft side of the Q-berth port hanging locker.
2. Run the wires from the monitor thru the inboard hole in the locker then place the monitor on the locker, making sure it is level, and attach the monitor to the furniture with the designated fasteners.
3. Connect the red wire from the monitor to the red/blue wire from the harness with a blue butt connector.
4. Connect the black wire from the monitor to the yellow wire from the harness with a blue butt connector.
5. Place the wires in 3/8" conduit and run it over to the 120 volt and 12 volt wires then place them all in larger conduit and run them down the aft-outboard corner of the locker.

Revision Dates:

Expected Time:

Page