356 SOP SHORE POWER OUTLET WIRING



SHORE POWER OUTLET IN PORTAFT CORNER OF THE DECK



INSIDE VIEW OF SHORE POWER OUTLET AFTER IT HAS BEEN WIRED

- 1. The shore power outlet is located on the aft-port end of the deck.
- 2. Unscrew the shore power outlet then remove the back and loosen the strain relief bracket.
- 3. Pull the loose end of the shore power romex wire (10 gauge) thru this hole (the other end of this wire will be connected to the shore power breaker reset). Run this wire thru the strain relief bracket into the back of the outlet. Strip the wires back then attach the white wire to the white ring on the outlet, attach the black wire to the black ring on the outlet and attach the green wire to the green ring on the outlet.
- 4. Tighten all of the connections well then tighten the strain relief bracket on the back of the power outlet.
- 5. Place the shore power outlet back in position with the gasket in place, caulk the mounting holes with white 739 caulk then secure the outlet to the deck.

Revision Dates: Expected Time: 15 min.